

SERVICE NOTES:

Jackson - 2SA473 failure, TR501. Original part specs 10W/3A. Change to an ECG-153, 50W/7A.

---

Teaberry, President, and Sanyo CB parts: Note-the old President parts have been sold off to following company. Also have the inventory of old Teaberry parts; and the SANYO built units. Any unit with the following PLL Chips is a SANYO unit: LC7110, LC7113, LC7120, LC7130, LC7131, LC7135, LC7136, LC7137.

B.C. Electronics  
4403 W. Franklin Road  
Indianapolis, Indiana 46226  
(317-549-2035)  
Attn: John Brown

---

DON'T ASK WHY?

....148GTL-DX (Late)....

Customer didn't like clarifier set-up as it came, couldn't understand dual controls.

"Wanted a different type like regular C.B. that had been changed over, and one control knob".

So; modified to his wishes with +5KHz of swing; and kept old pot/knobs as part of the deal.

1. Remove the Yellow wire from original dual pot, (front pot, middle).
2. Remove all existing wires remaining on original pots at PCB, put old pot/knobs/knob retainers in the 'goodie box'.
3. Obtain 20K linear taper pot, and rewire as below - then realign.

