



**Consumer Response Group**

6500 W. Cortland Street \* Chicago, IL 60707 \* Phone: 773-889-8870 \* FAX: 773-622-2269

---

November 13, 2002

Page 1 of 2

## **TECHNICAL SERVICE BULLETIN 10003**

**MODEL(S):** 25LTDST, 25NWST, 25WXNWST, 25WXST

**DESCRIPTION:** Squealing on transmit, only when Soundtracker is engaged.

**ACTION:** Check the SWR of the antenna, make sure it is below 3. Optimally the SWR should be below 2.5.

If the radio still squeals, remove C811 on the Soundtracker board. The Soundtracker board is a small board along the right-hand edge of the radio (with the radio is upside-down). C811 is located next to pin 9 of IC801 (IC801 is a TA31101). Refer to page 2 for a diagram of the location.

**ADJUSTMENTS:** None.

**NOTES:** None.

