



EQUIPMENT AFFECTED

Johnson VHF Mini-Scan  
Part No. 241-0352-xxx

REASON FOR REVISION

Eliminate audio distortion by changing the audio rolloff characteristic of the audio driver.

REVISION

1. Replace capacitor C35 with a 0.01  $\mu$ F capacitor.
2. Replace capacitor C37 with a 220  $\mu$ F capacitor.
3. Replace R38 with a 47K ohm resistor.

PARTS REQUIRED

| <u>QTY</u> | <u>PART NUMBER</u> | <u>PART DESCRIPTION</u>                                |
|------------|--------------------|--|
| 1          | 510-3010-103       | C35, capacitor 0.01 $\mu$ F<br>$\pm 20\%$ 16V Y5S disc |
| 1          | 510-2021-221       | C37, capacitor 220 $\mu$ F                             |
| 1          | 569-1010-473       | R38, resistor 47K ohm<br>$\pm 10\%$ , 1/8 W            |

CHANGE ACTION

Make this change as required. This change is included in the "B" model receivers.