


COLT 1200 EXCALIBUR

SERVICE TIP: Replace small wires from PCB to Power Supply with 18 ga wire, and shorten to only length needed....

TRS CHALLENGER 850/1400-UPDATE

1. Refer to Vol 4 for Freq/Slide modifications.
2. For -5KHz shift wire as follows:

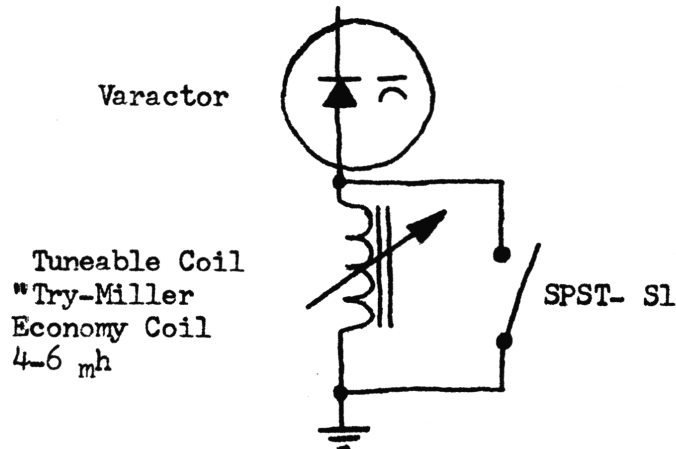

- A. Adjust center slots for center clarifier position with S1 closed.
- B. Open switch and adjust coil for -5KHz shift at center clarifier position

(Note: On 850-NB/ANL switches perfect for channel mod/shift.)

LAFAYETTE CHB740

See PLL02A info: Vol. 4 for Freq. mod.
Peak L7, L11, L12-max RF. RV4-TX Mtr. RV1-Sq Rng.
RV2-AMC (C96, defeat) RV3-S Mtr.

CHANNEL MASTER CB6830

AMC defeat is C511, 3.3mf/50VDC, located near VR7...

MIDLAND 77-853

Peak L205, L903, L901 for max RF. VR1-AGC VR7-AMC
VR5-TX Mtr.

COBRA 148GTL-B

Another EXPORT unit, this is all I know at present: Cybernet Chassis; goes to 27.605MHz in original form; (with readout on the chassis). Built-in SWR meter; switches all over the front. Made in Japan! Has 2SC1969(20W/6A Final) --For Tune-up and extras refer to HYGAIN V..Out of box operation is sloppy about 5½ AM, and 10 SSB....Have also heard other RUMORS, like don't ask COBRA for a manual???