


SPECIFIC RADIO TUNE-UPS cont'd.:

GEMTRONICS GTX 5000  
ROBYN T240D

This unit has had problems with the 6BQ5 tubes going out very quickly. I have replaced them with 7189 tubes and have had no further problems. It also helps increase modulation.

GENERAL ELECTRIC 3-5871A

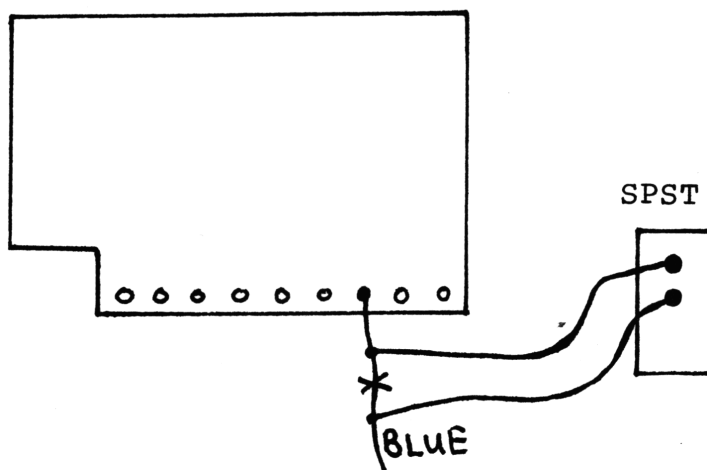

Clip Blue wire coming form PLL and add Switch.

- T802 VCO Coil.
- VR1 AGC Adj. for 1.45V @ TP1.
- VR10 RF Gain.
- VR3 Squelch threshold;
- VR4 "S" Meter
- VR6 AM Mod. Control.
- VR7 RF Panel Meter.
- Peak L901, L903, L905.