
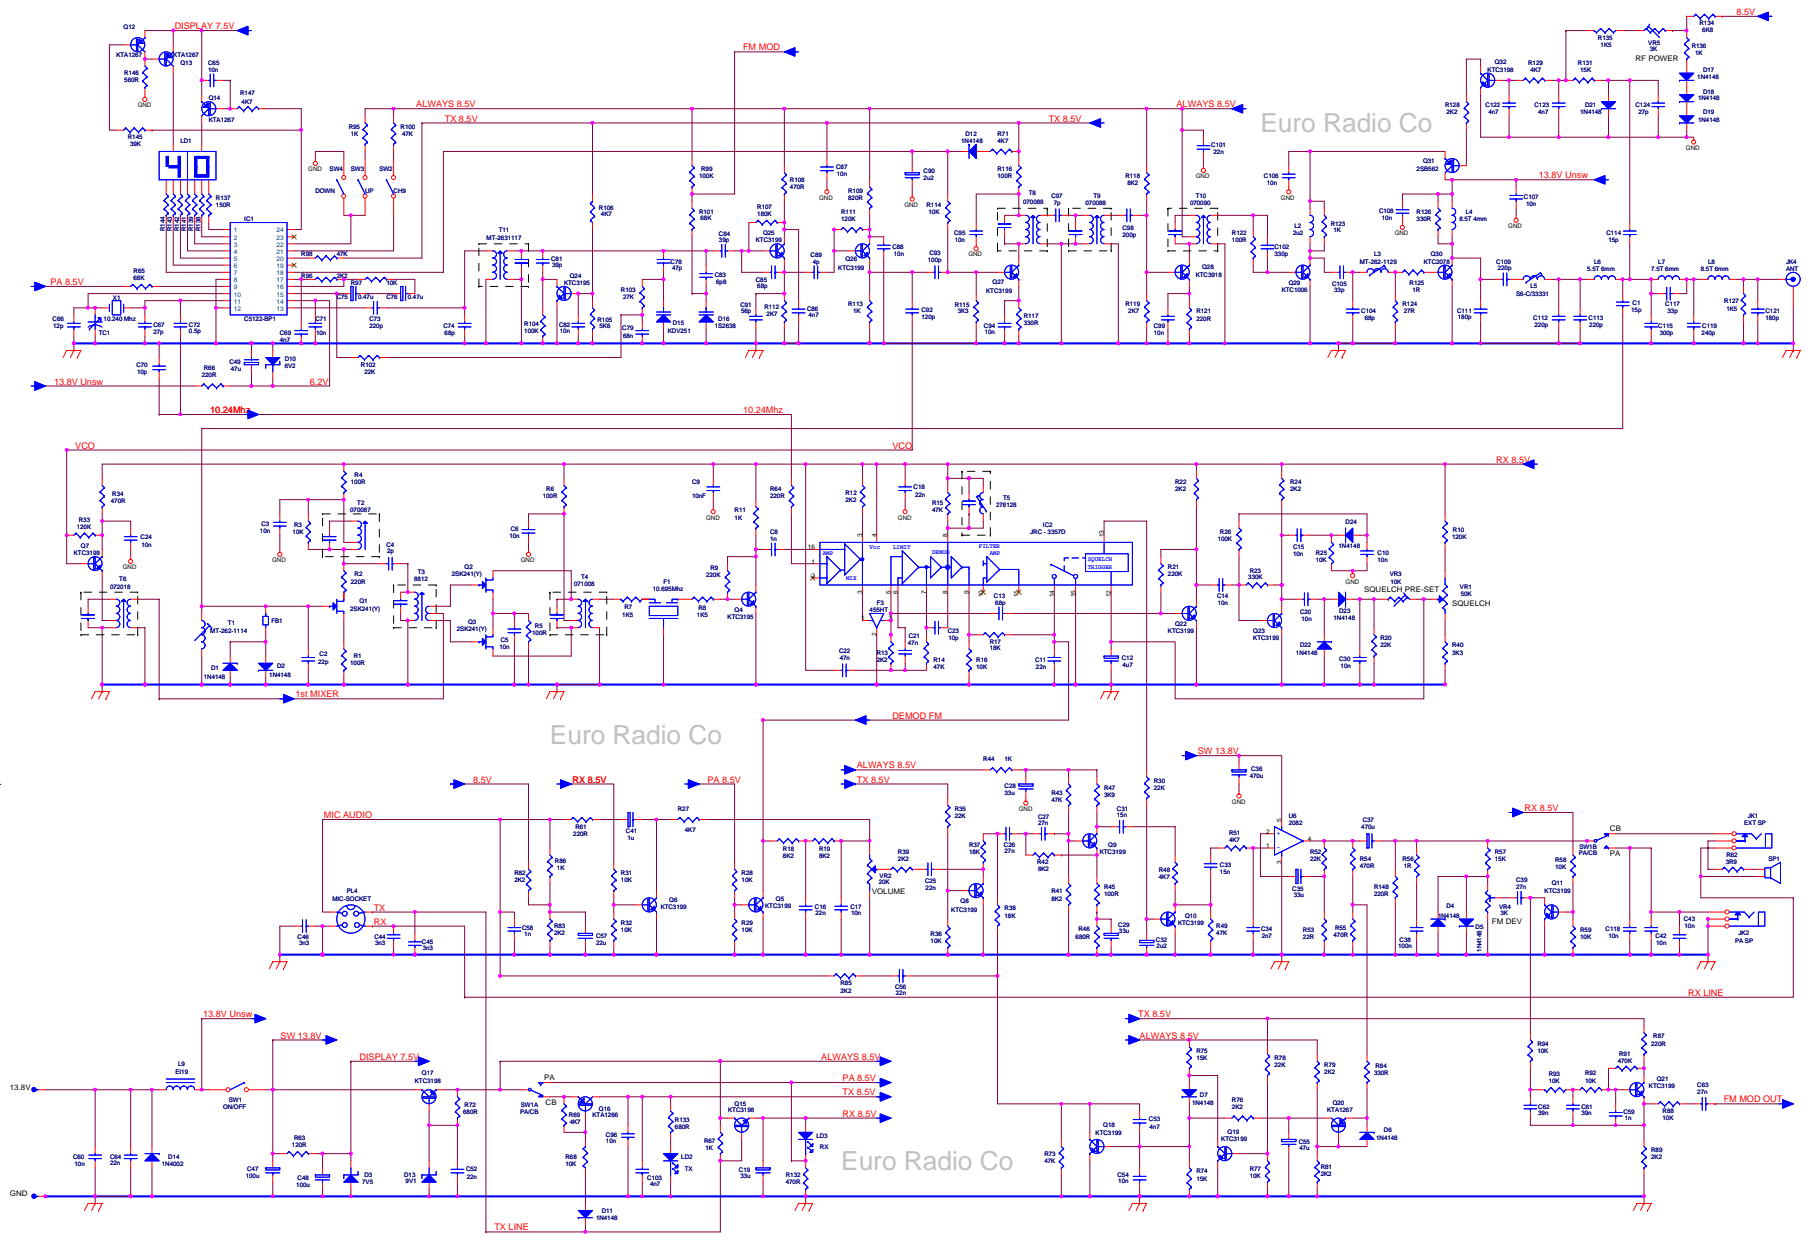


BETA 1100

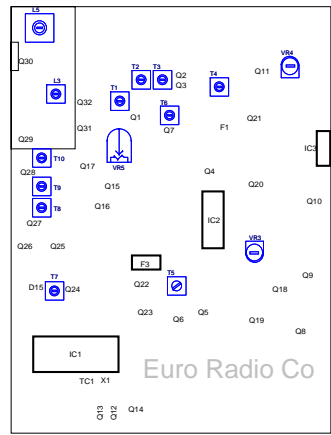

NOTES:
 Low RF output check R125 (1R) none to go hi.
 No RF output check Q31 replace with 1 amp device.
 Noise in RF output sounds like white noise check R123 (1K).
 VCO only locking over a few channels check C78 (47P).